

INSTALLING THE FALCON 4 High Speed Serial Converter & USB Port Driver


(This must be done through the Windows hardware installation wizard, and in the order shown.)

WINDOWS 2000/XP: Connect the USB cable (not included) from the Falcon printer to the computer, and turn the printer ON. The FOUND NEW HARDWARE WIZARD will start as shown...

<http://www.censystems.com/>




CLICK "No, not this time" and then NEXT


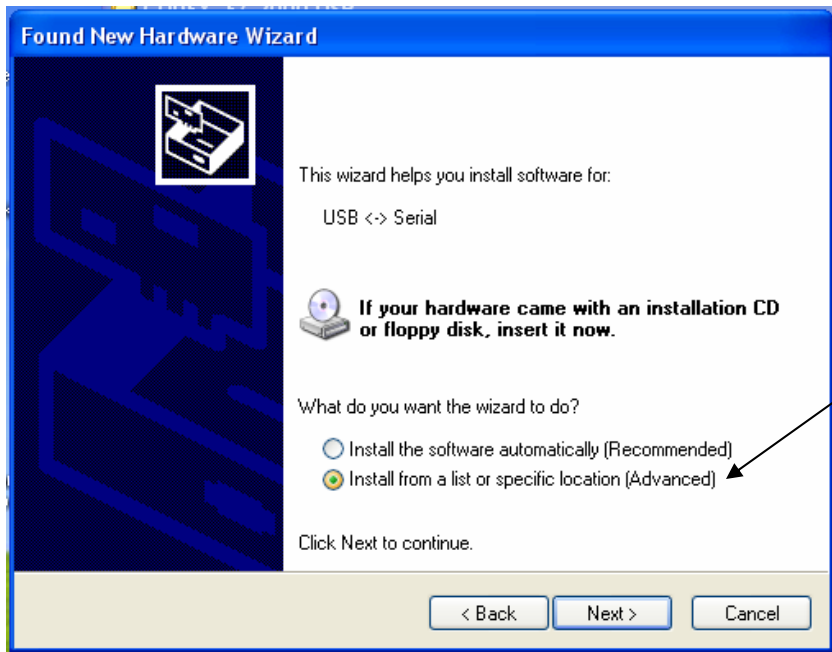


CLICK "Install from a list or specific location (Advanced)" and then NEXT

Be sure that your USB Port CD is in your CDROM drive and browse to the directory: X:\USB\GODEX EZ-2000 USB (Replace X with your CDROM drive letter.) and click NEXT

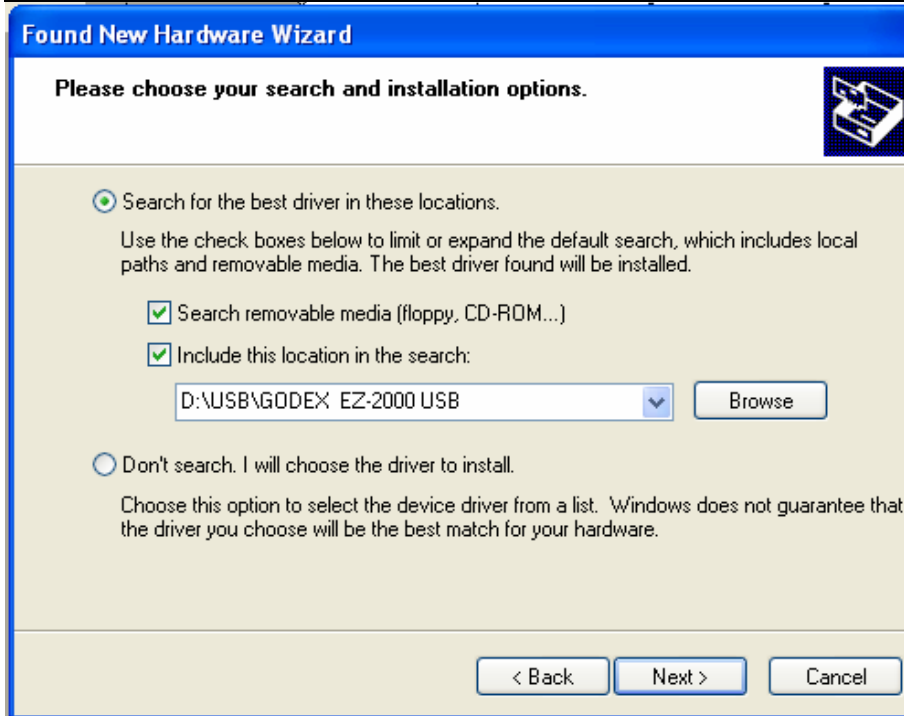

USB High Speed Serial Converter will be loaded. The COMPLETING Found New Hardware Wizard Finish window will open. Click FINISH.

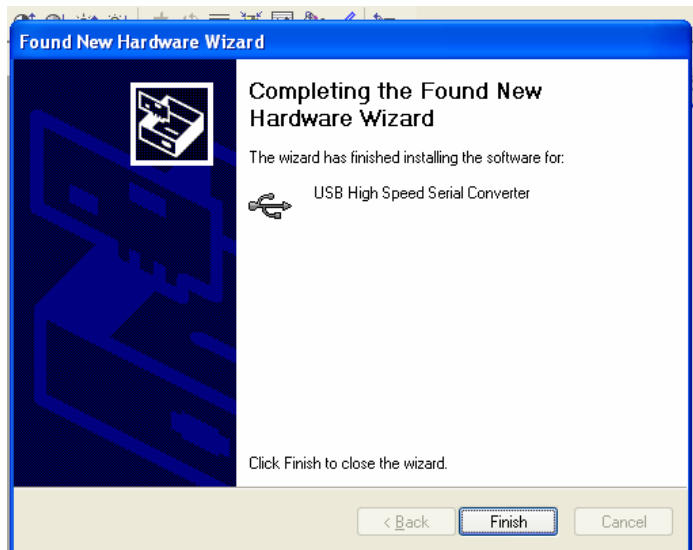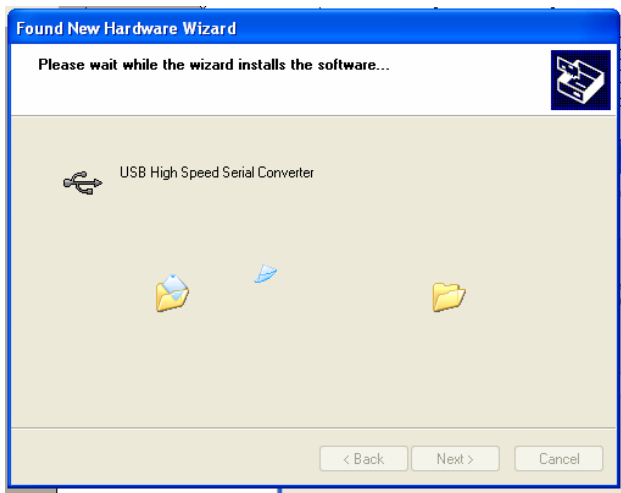


INSTALLING THE FALCON 4 USB PORT DRIVER

(This is a continuation of the USB High Speed Serial Converter driver installation.)

The Found New Hardware Wizard Screen will show again.




CLICK "No, not this time" and then NEXT

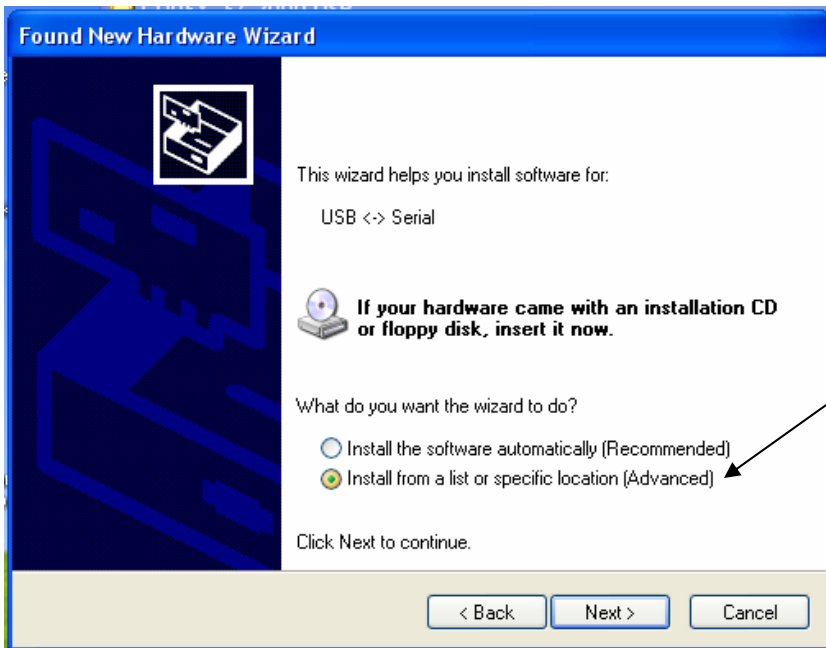

CLICK "Install from a list or specific location (Advanced)" and then NEXT

Be sure that your USB Port CD is in your CDROM drive and browse to the directory: X:\USB\GODEX EZ-2000 USB (Replace X with your CDROM drive letter.) and click NEXT

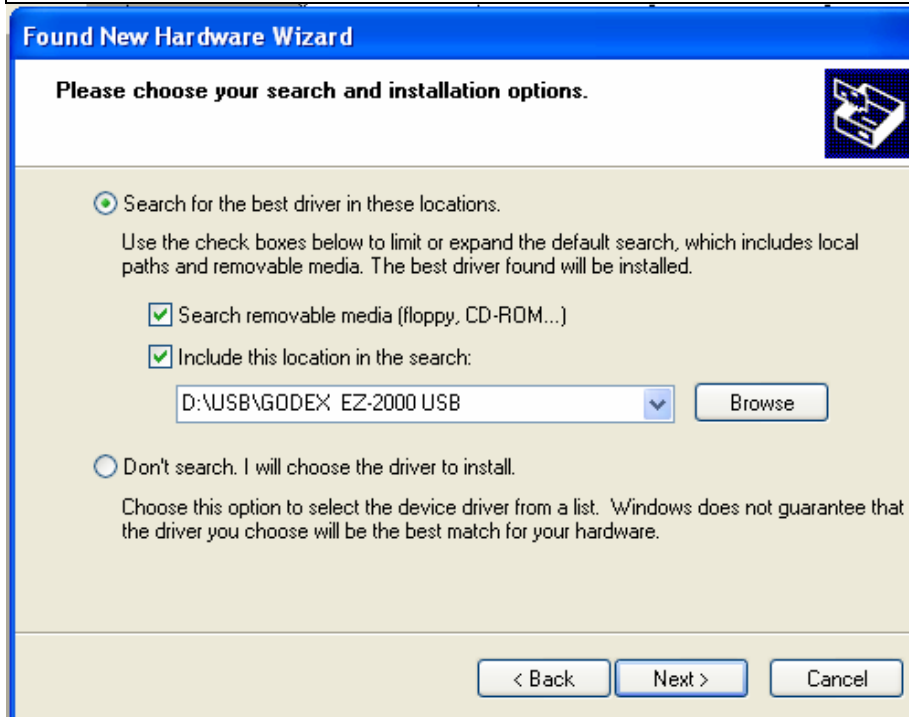

The hardware wizard will search for the USB Serial Port driver and install it. One finished, it will show the COMPLETING the Found New Hardware Wizard window as shown. Click Finish- Drivers are installed.

